

SAN DIEGUITO WETLANDS RESTORATION PROJECT

25 JUNE 2015 BEACH PROFILES CITY OF DEL MAR, CALIFORNIA

Data Report



Prepared by

Coastal Environments
2166 Avenida de la Playa, Suite E
La Jolla, CA 92037

Prepared for

Southern California Edison Company
2244 Walnut Grove Avenue
Rosemead, CA 91770

15 July 2015
CE Reference No 15-24

TABLE OF CONTENTS

1.0	INTRODUCTION	1
2.0	PERMIT REQUIREMENTS	1
3.0	METHODS AND PROCEDURES	1
4.0	BEACH PROFILE SURVEY RESULTS	3
5.0	REFERENCES	4

LIST OF APPENDICES

Appendix A.	25 June 2015 Beach Profiles.....	A-1
Appendix B.	25 June 2015 Beach Widths.....	B-1

LIST OF TABLES

Table 1.	Beach profile onshore survey marker locations.....	2
Table 2.	Beach width adjustment to City of Del Mar Shoreline Protection Area Line	6
Table B-1.	Beach widths (ft) from 25 June 2015 beach profile surveys referenced to benchmarks	B-2
Table B-2.	Beach widths (ft) from 25 June 2015 beach profile surveys adjusted to City of Del Mar Shore Protection Area	B-2

LIST OF FIGURES

Figure 1.	Schematic illustration of survey method.....	5
Figure 2.	Beach profiles surveyed on 25 June 2015.....	7
Figure A-1.	Beach profile for SIO1 surveyed 25 June 2015	A-2
Figure A-2.	Beach profile for SIO2 surveyed 25 June 2015	A-3
Figure A-3.	Beach profile for SIO5B surveyed 25 June 2015	A-4
Figure A-4.	Beach profile for SIO6 surveyed 25 June 2015	A-5
Figure A-5.	Beach profile for SIOA surveyed 25 June 2015. Multiple attempts were made to fill in data gap between -5 and -8 ft, NGVD, strong currents and surf prevented data acquisition in this area.	A-6
Figure A-6.	Beach profile for SIOB surveyed 25 June 2015	A-7
Figure A-7.	Beach profile for SIOC surveyed 25 June 2015	A-8

SAN DIEGUITO WETLANDS RESTORATION PROJECT

25 JUNE 2015 BEACH PROFILES AT CITY OF DEL MAR, CALIFORNIA

Data Report

1.0 INTRODUCTION

This report describes the beach profiles surveyed along the Del Mar and Solana Beach coastline near the San Dieguito Lagoon inlet on 25 June 2015. The survey program is designed to comply with permit conditions set forth in the Coastal Development Permit (No. 06-04-088) issued by the California Coastal Commission (CCC) for the San Dieguito Wetlands Restoration Project.

2.0 PERMIT REQUIREMENTS

The permit requires offshore beach profiles to be performed at seven (7) profile locations near the inlet to the San Dieguito Wetlands. Four (4) of the profiles are to be at historic profile locations, including DM-0590 (SIO1), DM-0580 (SIO2), SIO5B, and SIO6. Three (3) new profile locations are located south of SIO1: 500 feet (SIOA), 1,000 feet (SIOB), and 1,500 feet (SIOC) south of SIO1. Table 1 outlines the locations of the beach profiles.

The permit also requires that full profile (offshore/onshore) surveys are to be performed in the spring (April) and fall (October) for the seven profiles, and wading/onshore profiles are to be performed quarterly. All of the surveys are to be referenced to the City of Del Mar's Shore Protection Area (SPA) line, or to a fixed and identified feature for the site north of the SPA line (SIO6). The full profile surveys are to go to the depth of closure, where there are no substantial changes in bottom profile due to seasonal variations in wave conditions. The depth of closure has ranged from 35 ft to 50 ft in San Diego County (SANDAG, 2009).

This report provides beach profile data and analysis of the summer 2015 beach profile surveys carried out on 25 June 2015, as required by the permit.

3.0 METHODS AND PROCEDURES

The beach profiles were conducted from the benchmarks to wading depth by total station and prism. Data were acquired along each transect from the survey marker to an offshore limit below MLLW (Mean Lower Low Water). Each survey marker (benchmark) was located at the back beach at a fixed point, primarily along a protective seawall. Data were collected at least to -6 ft, MLLW.

The beach and surf zone were surveyed using an electronic total station and survey rod. The total station was used to determine the position and elevation of the beach at each location

Table 1. Beach profile onshore survey marker locations.

Benchmark	California State Plane Coordinates, Zone 6 (ft), NAD83		Elevation, NGVD29 (ft)
	Northing	Easting	
SIO1	1935951.7	6248823.5	13.5
SIO2	1934061.9	6249131.2	13.5
SIO5B	1936545.5	6248645.2	14.9
SIO6	1938477.3	6248035.2	18.0
SIOA	1935521.4	6248888.9	14.8
SIOB	1935008.3	6248975.3	14.7
SIOC	1934488.5	6249054.7	15.3

occupied by the rod. A Sokkia Set-5A total station and SDR-33 electronic field data logger were utilized to collect the nearshore portion of the profile, providing an accuracy of approximately 2-4 cm both horizontally and vertically. The total station method reflects an infrared beam sent from the device to a prism atop a fixed-length pole, where the instrument measures the slant distance and horizontal and vertical angles to the target (Figure 1). An electronic field data logger is used to store the data, which can then be set to known positions using permanent local benchmarks. Each transect was surveyed from the back beach seaward through the surf zone until the rod no longer protruded above the water surface.

The beach width was calculated from the Del Mar SPA line to 0 ft, NGVD, except for SIO6, which was calculated from the benchmark. The distance of the profile benchmarks to the SPA line is shown in Table 2.

4.0 BEACH PROFILE SURVEY RESULTS

The summer 2015 beach profile surveys were performed on 25 June 2015, along the four historic and three newly established profiles (Figure 2). One of the three new profile locations, SIOA, has a data gap between the depths of -5 and -8 ft, NGVD. Multiple attempts were made to fill in this data gap on SIOA, however, strong rip currents in the surf zone created unsafe working conditions precluding our ability to obtain bathymetric readings. The beach profiles are presented in Appendix A. The beach width for each of the profiles is presented in Appendix B.

5.0 REFERENCES

SANDAG, 2009. Regional Beach Monitoring Program. Annual Report, June 2010, Chatsworth, CA. 111 pp. + app.

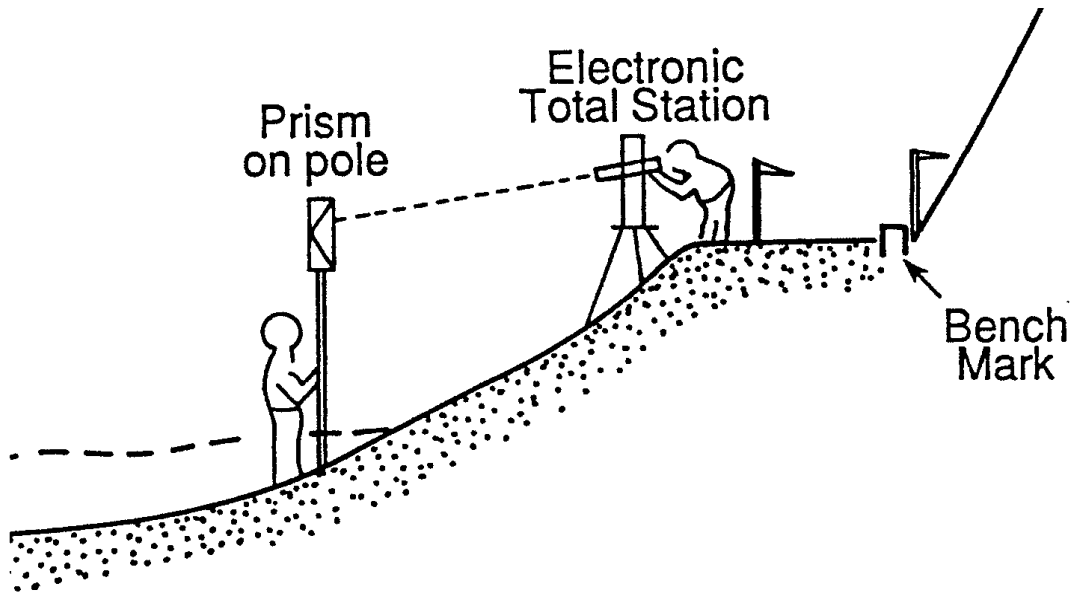


Figure 1. Schematic illustration of the survey method.

Table 2. Beach width adjustment to City of Del Mar Shoreline Protection Area Line.

Benchmark	Adjustment (ft)
SIO1	+1.4
SIO2	+1.0
SIO5B	+32.2
SIO6	0
SIOA	+1.5
SIOB	-4.2
SIOC	+9.3

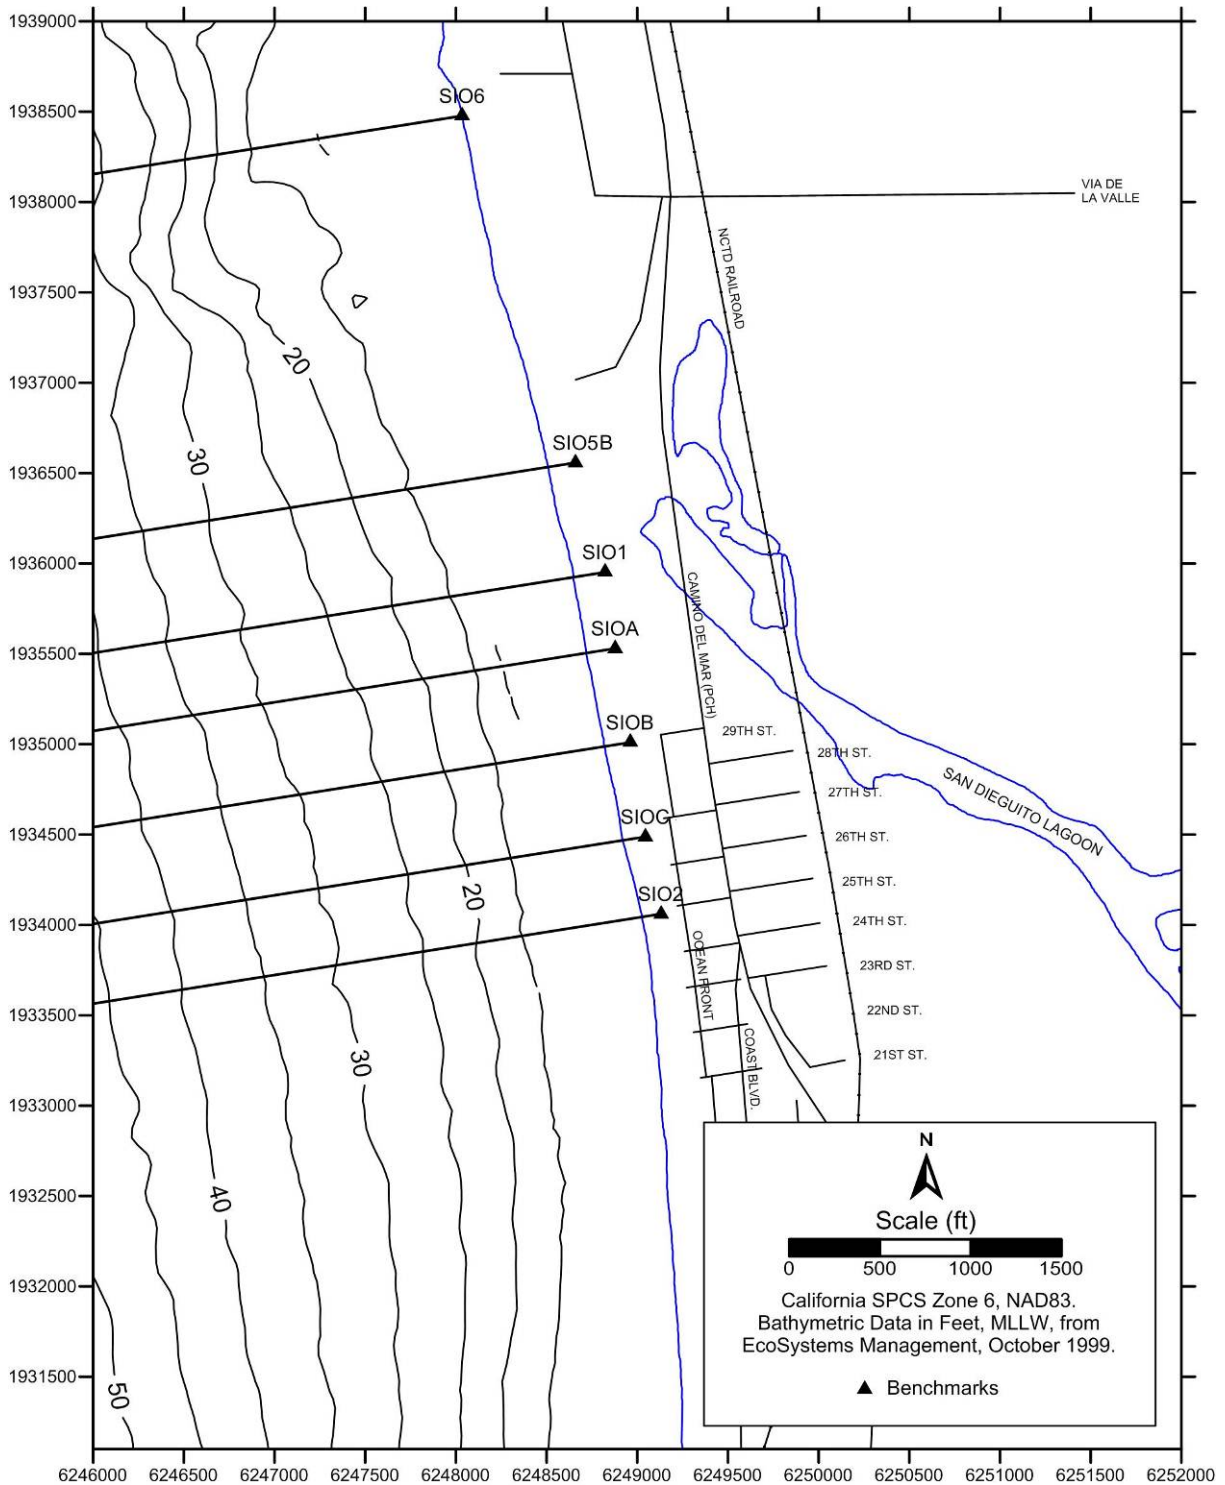


Figure 2. Beach profiles surveyed on 25 June 2015.

APPENDIX A
25 JUNE 2015
BEACH PROFILES

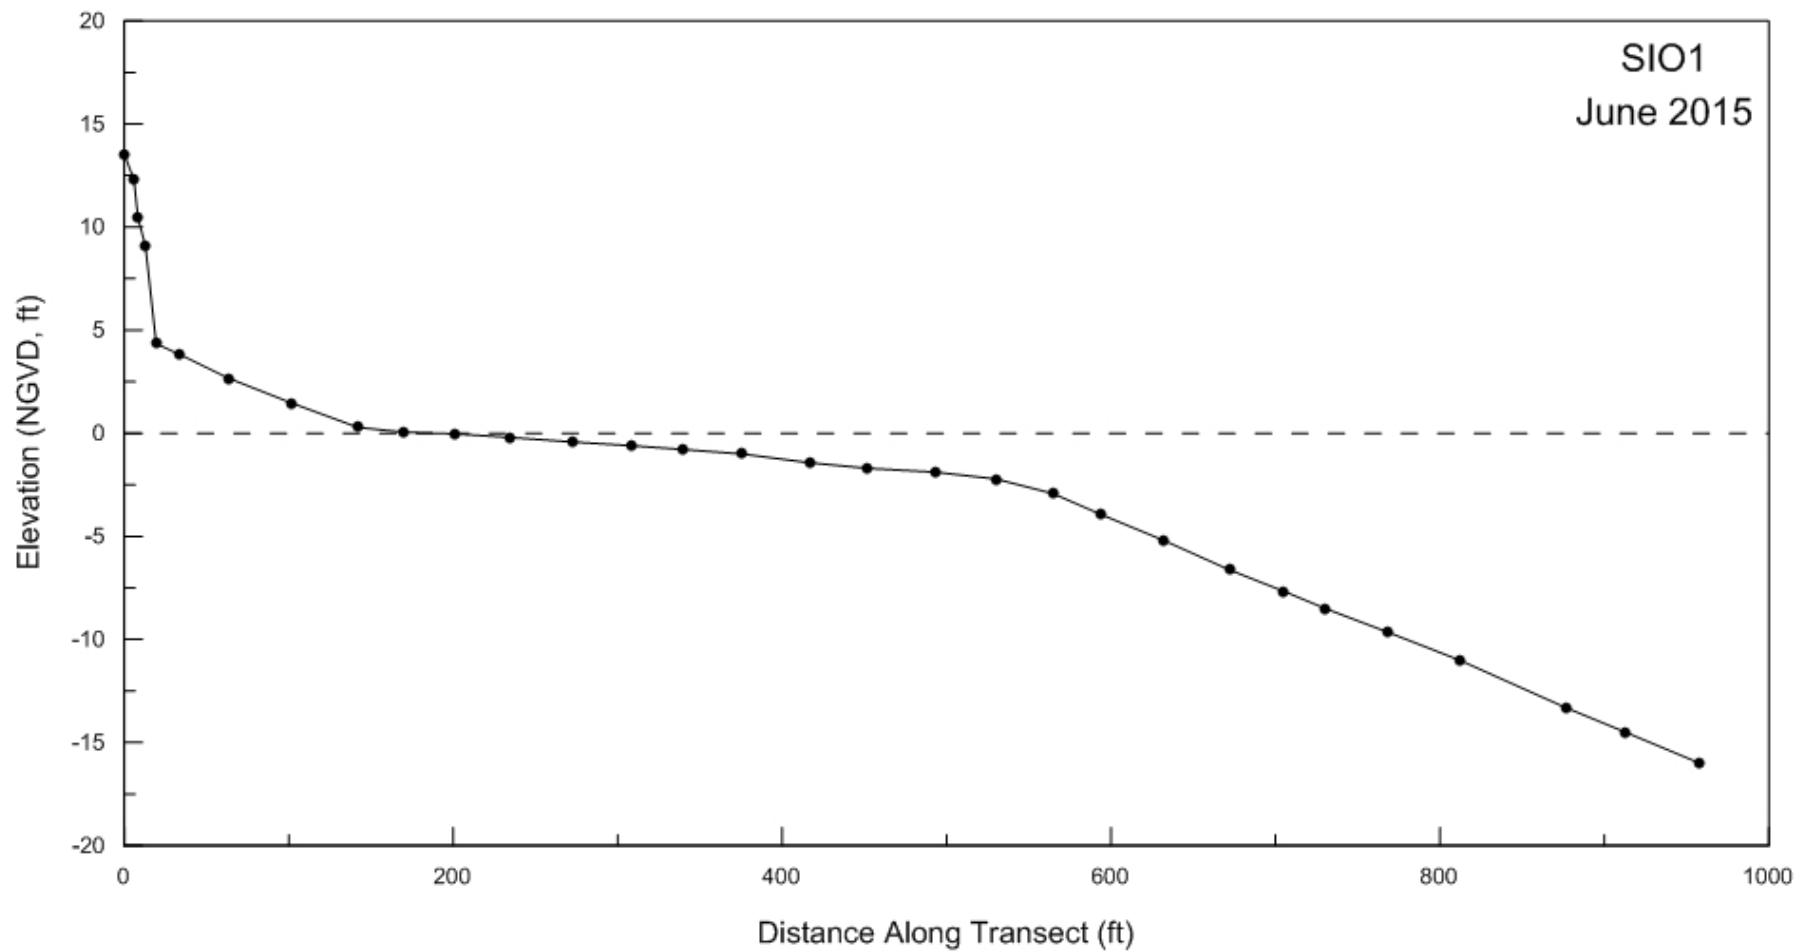


Figure A-1. Beach profile for SIO1 surveyed on 25 June 2015.

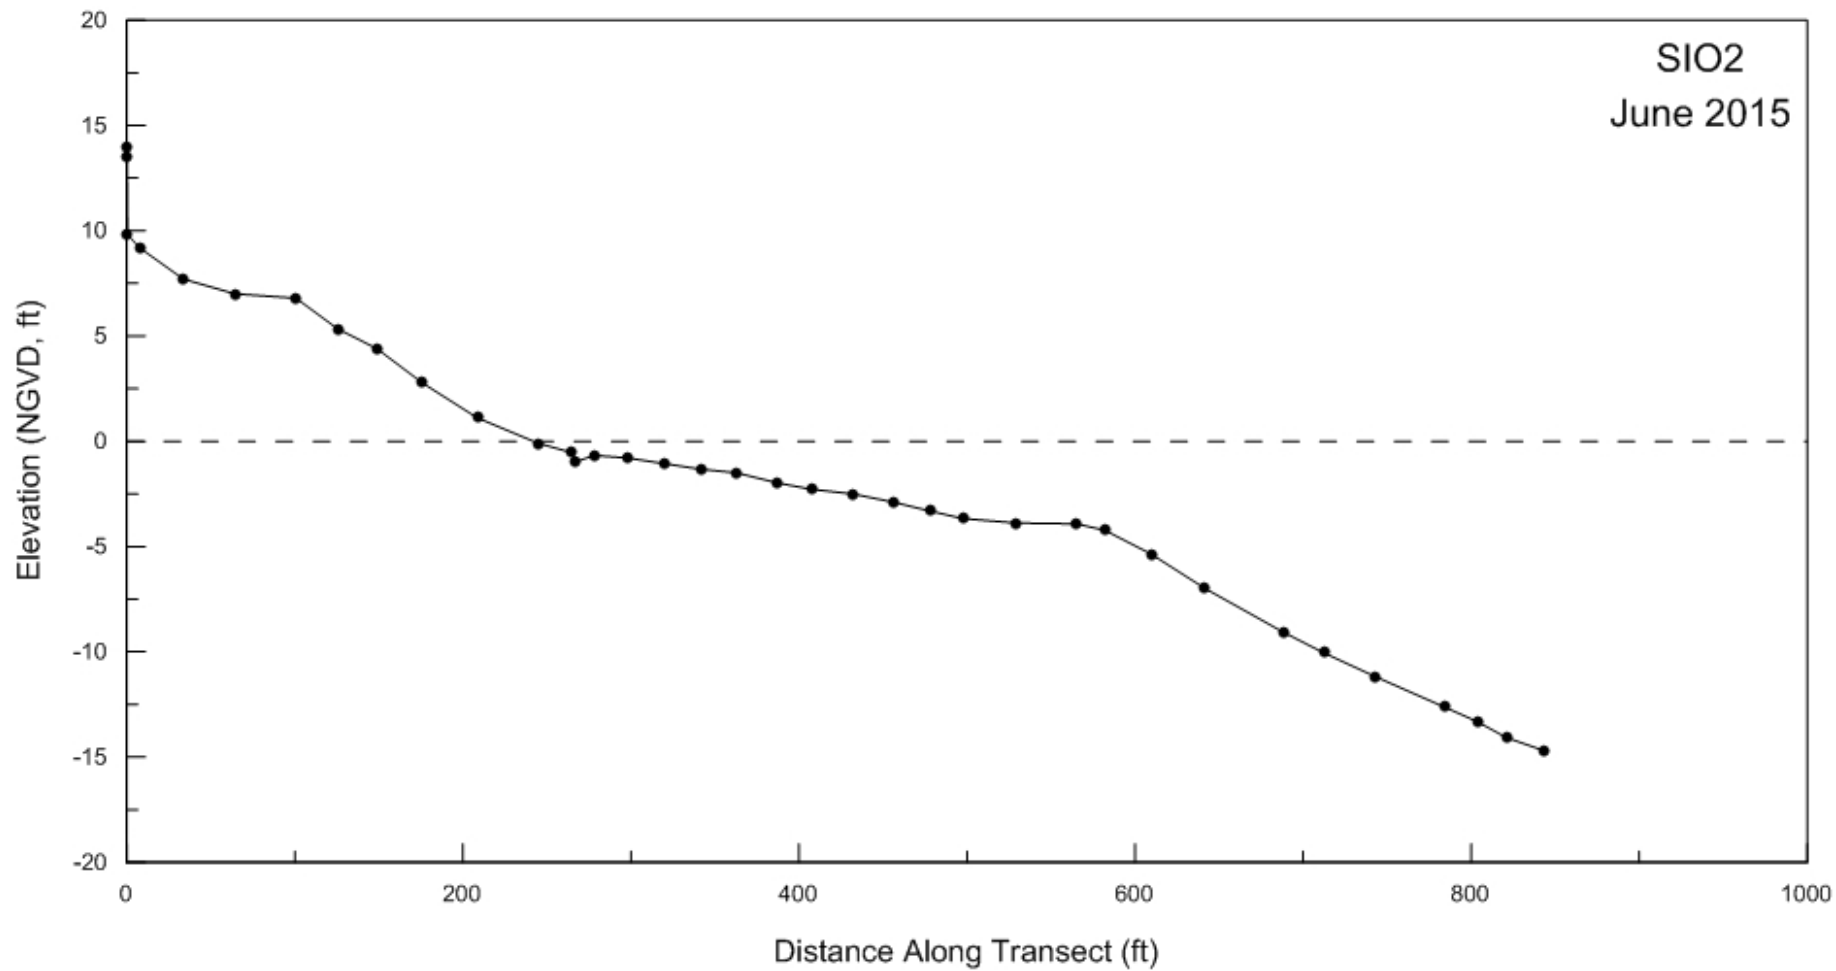


Figure A-2. Beach profile for SIO2 surveyed on 25 June 2015.

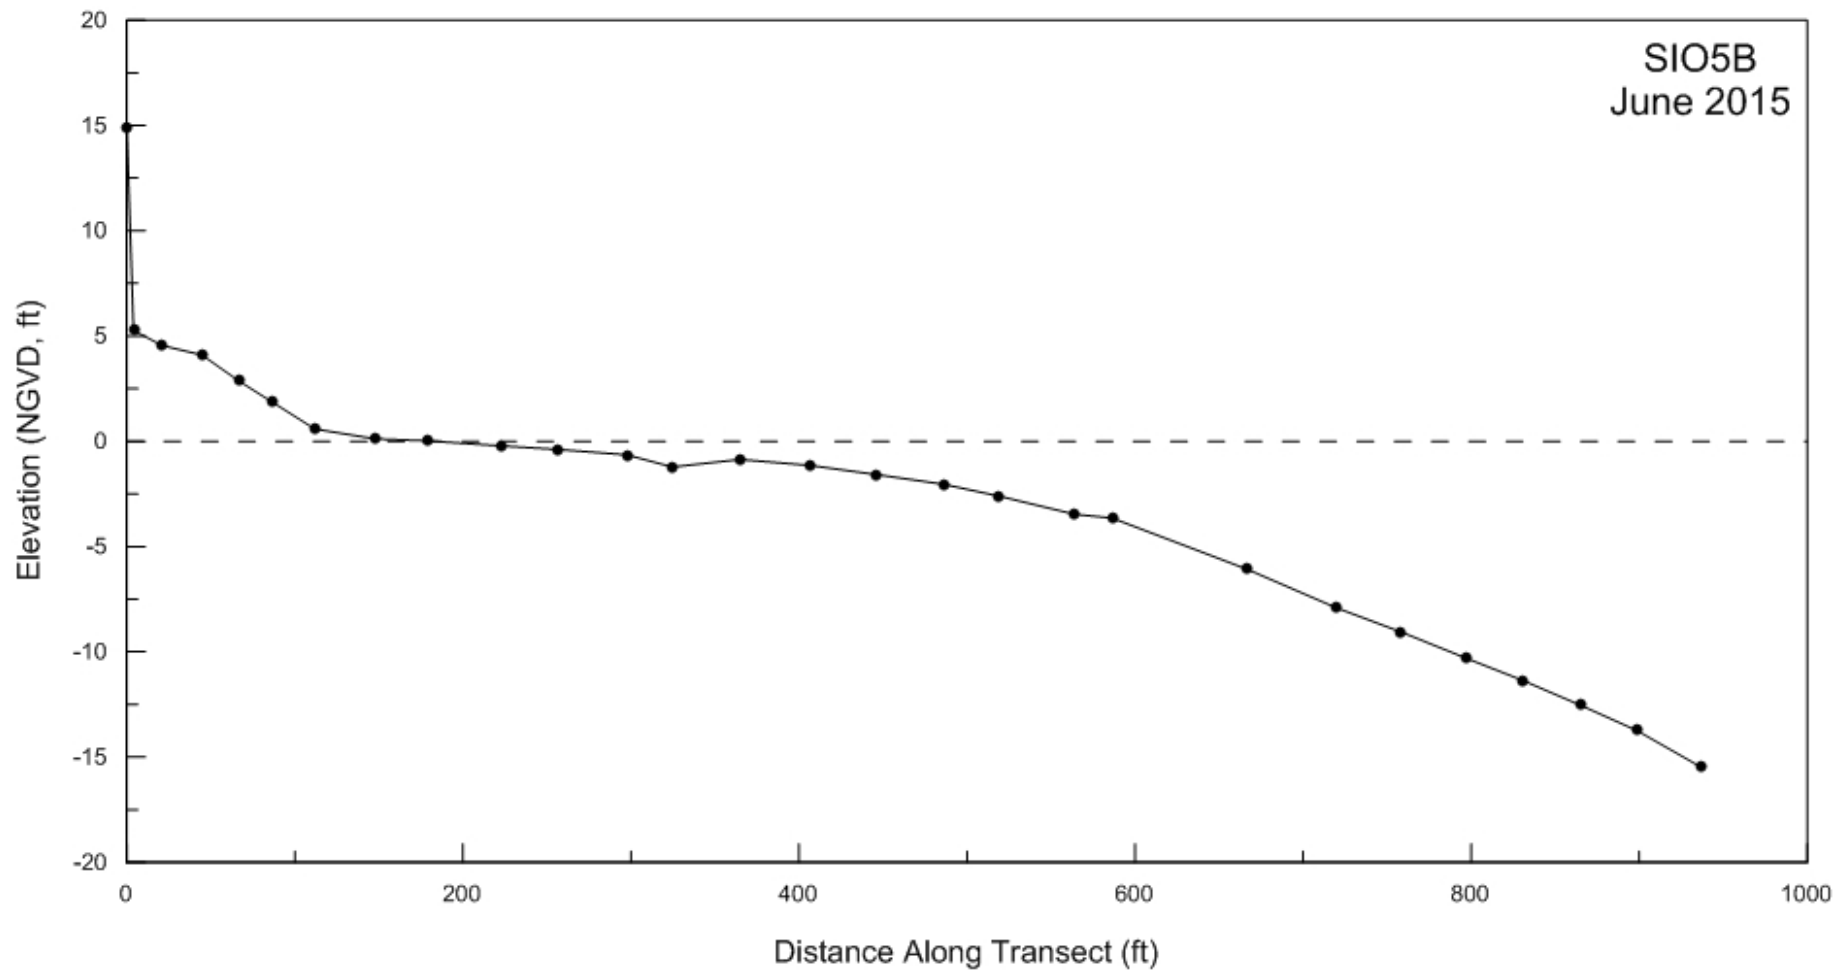


Figure A-3. Beach profile for SIO5B surveyed on 25 June 2015.

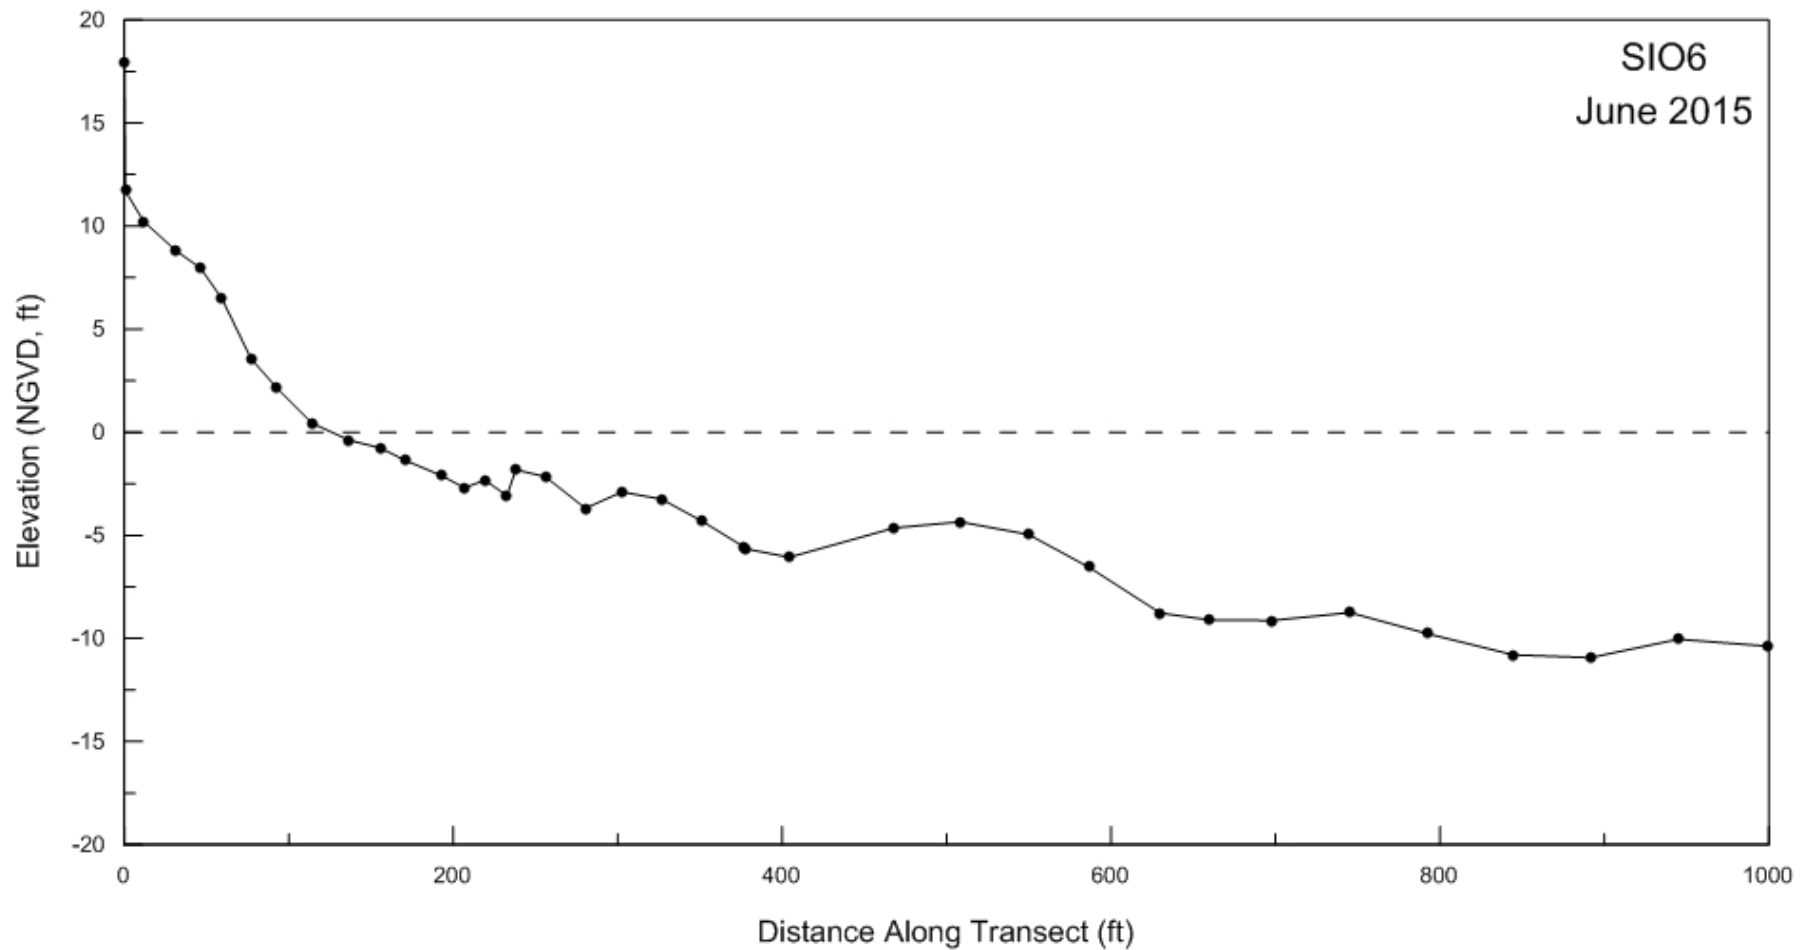


Figure A-4. Beach profile for SIO6 surveyed on 25 June 2015.

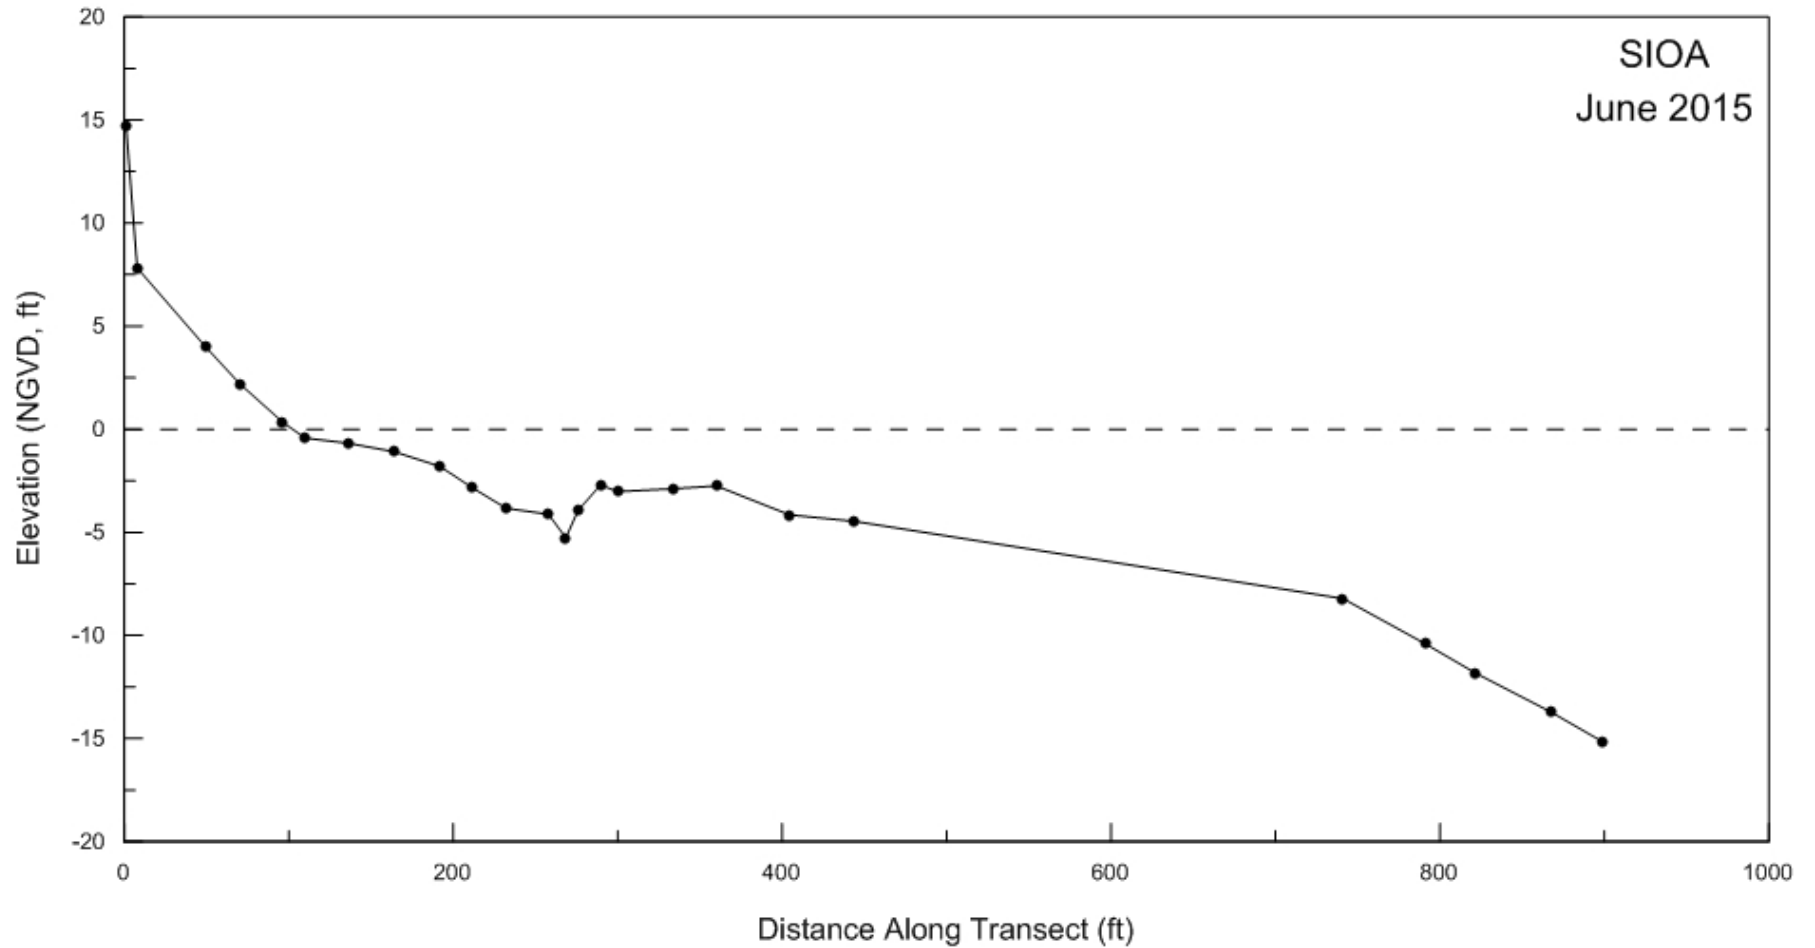


Figure A-5. Beach profile for SIOA surveyed on 25 June 2015. Multiple attempts were made to fill in data gap between -5 and -8 ft, NGVD, strong currents and surf prevented data acquisition in this area.

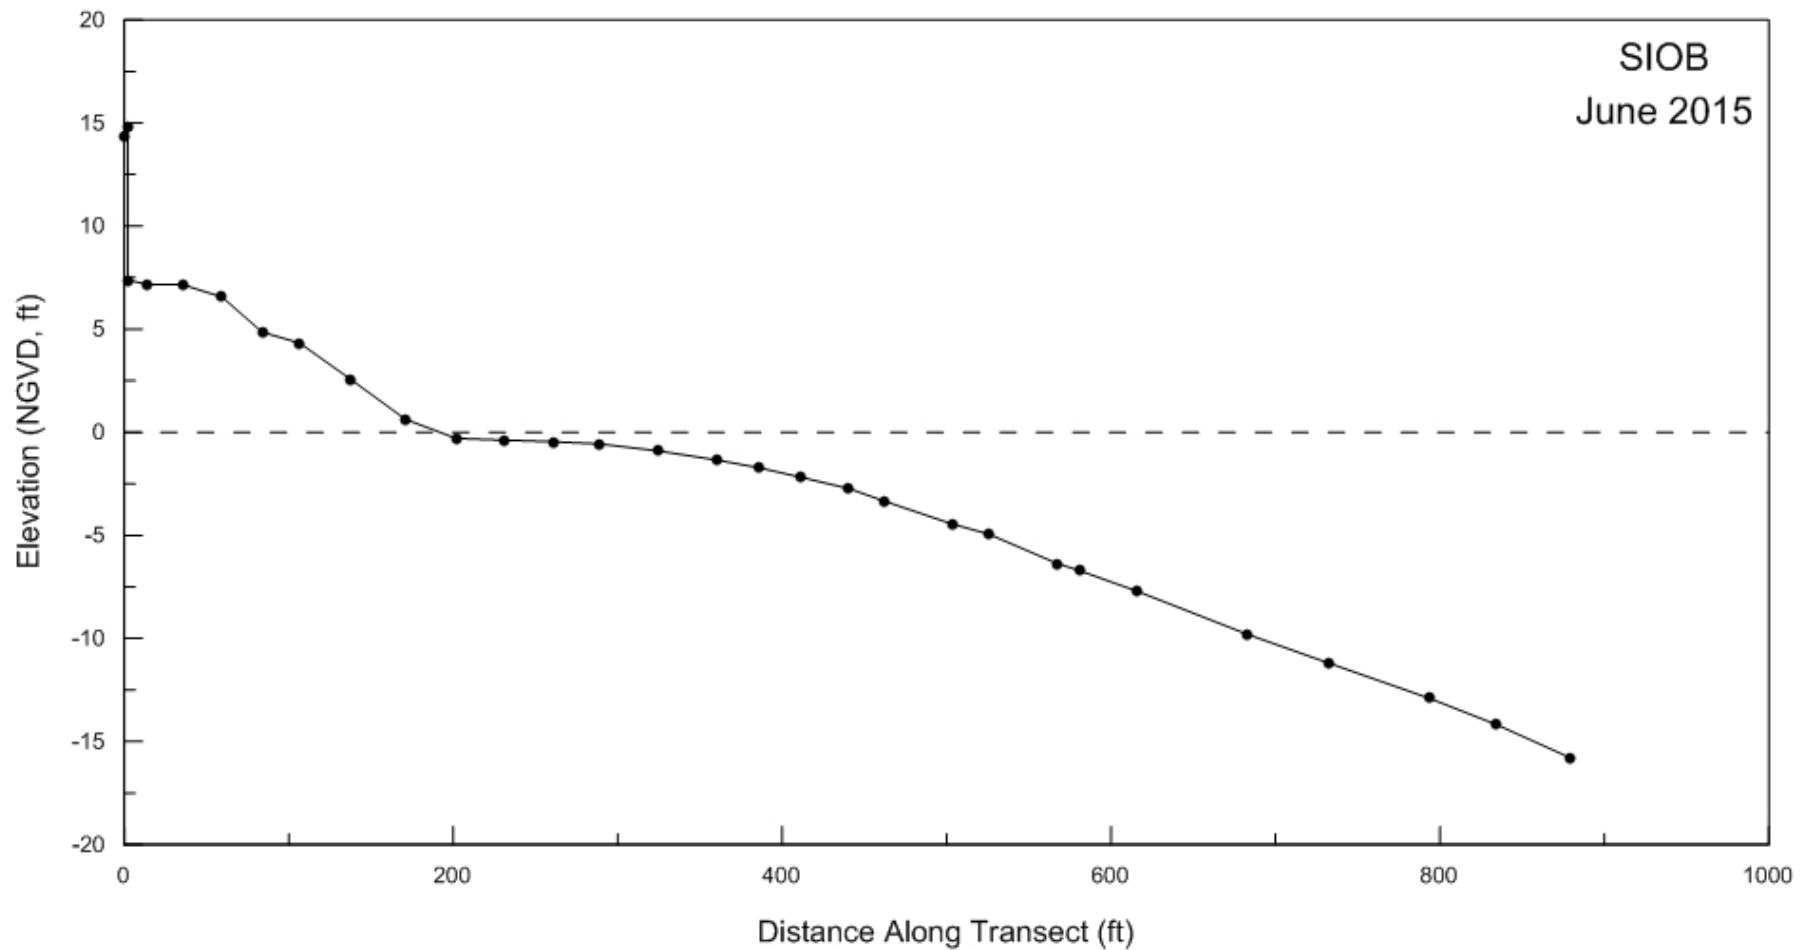


Figure A-6. Beach profile for SIOB surveyed on 25 June 2015.

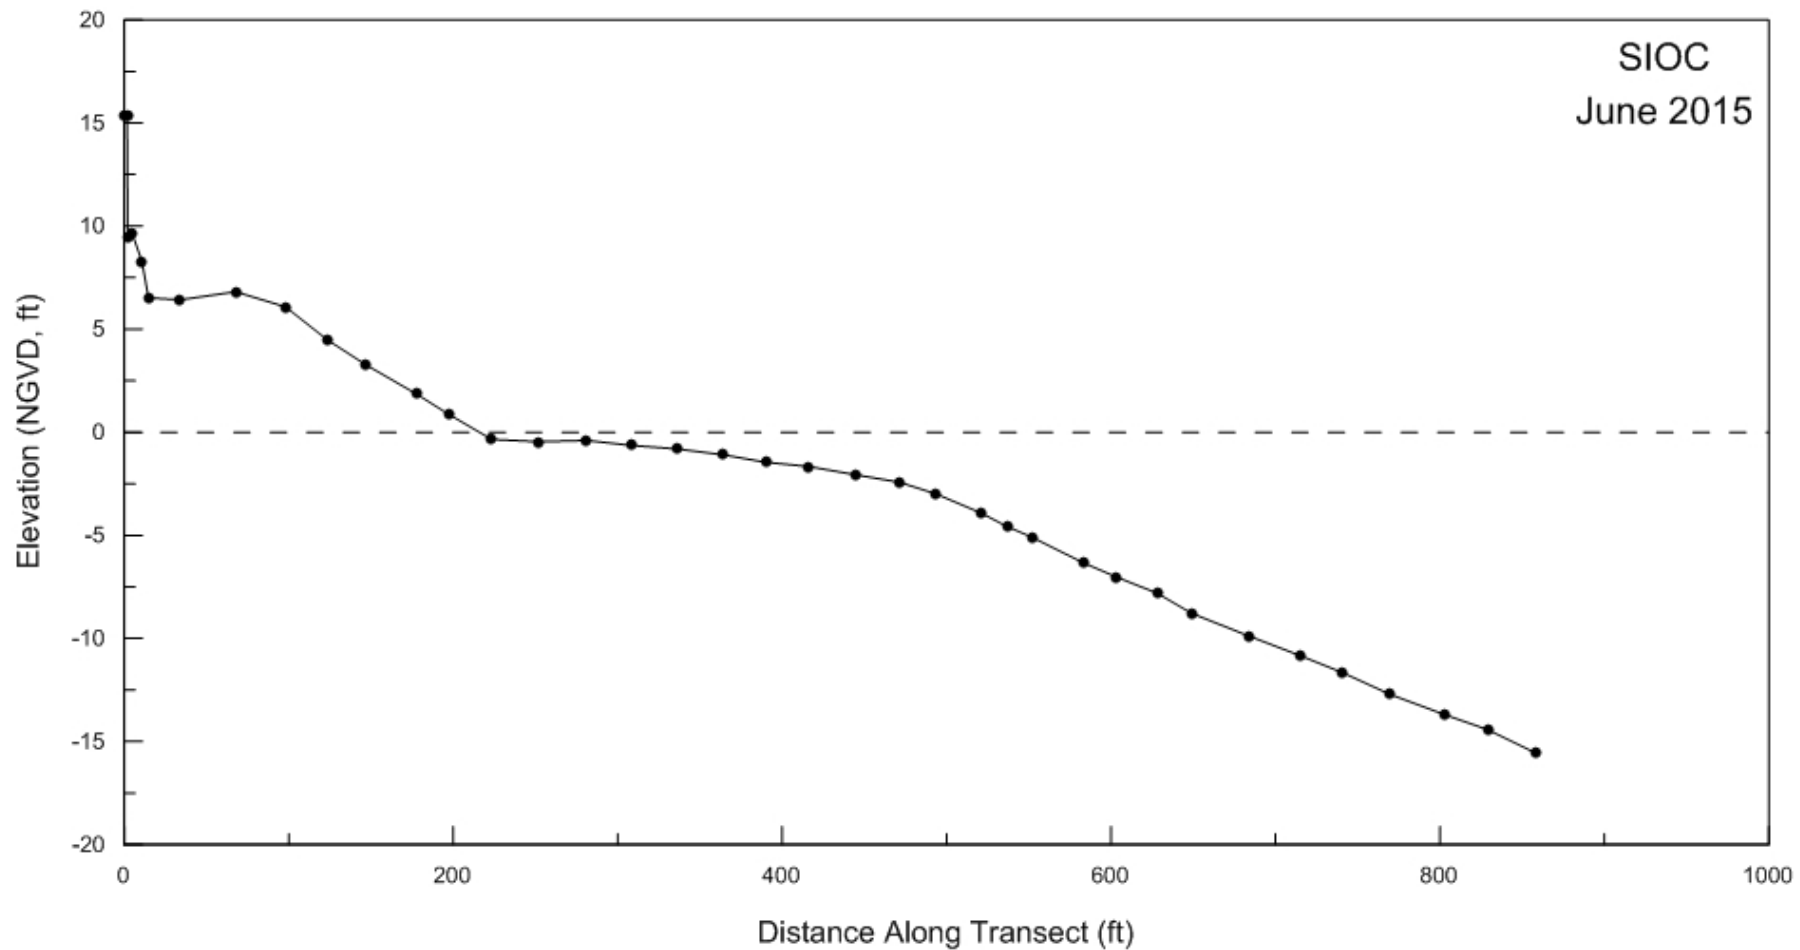


Figure A-7. Beach profile for SIOC surveyed on 25 June 2015.

APPENDIX B
25 JUNE 2015
BEACH WIDTHS

Table B-1. Beach widths (ft) from 25 June 2015 beach profile surveys referenced to benchmarks.

Date	SIO1	SIO2	SIO5B	SIO6	SIOA	SIOB	SIOC
25 June 2015	189.13	241.89	182.64	126.18	102.29	191.8	215.83

Table B-2. Beach widths (ft) from 25 June 2015 beach profile surveys adjusted to City of Del Mar Shore Protection Area.

Date	SIO1	SIO2	SIO5	SIO6	SIOA	SIOB	SIOC
25 June 2015	190.53	242.89	214.94	126.18	103.79	187.6	225.13

Note CCC conditions:

- (1) The beach width at DM-0590 (SIO1) is at or less than 32.4 feet (the lowest historically observed minimum);
- (2) The beach width at DM-0590 (SIO1) is at or less than 90 feet and there is more than a 180-foot difference in beach widths measured at DM-0590 and DM-0580 (SIO1 and SIO2); or
- (3) The beach width at SD-0595 (SIO5) is at or less than 74 feet (the lowest historically observed minimum).